

Hydraulic Technologies  
 5885 11th Street  
 Rockford, IL 61109-3699 USA

Tech. Services: (800) 477-8326  
 Fax: (800) 765-8326  
 Order Entry: (800) 541-1418  
 Fax: (800) 288-7031

Internet Address:  
<http://www.powerteam.com>

## Parts List for:

100841	100849
100842	100870
100848	100871


 MODEL B  
**DOUBLE-ACTING SWING CLAMP**

**Max. Capacity: 2400 Lbs. Clamping Force (with 2" Lg. arm) at 5,000 PSI**

**100841 - L.H., 1/2" Stroke; 100842 - R.H., 1/2" Stroke**

**100848 - L.H., 1-1/4" Stroke; 100849 - R.H., 1-1/4" Stroke**


**100870 - Straight Pull, 1/2" Stroke; 100871 - Straight Pull, 1-1/4" Stroke**

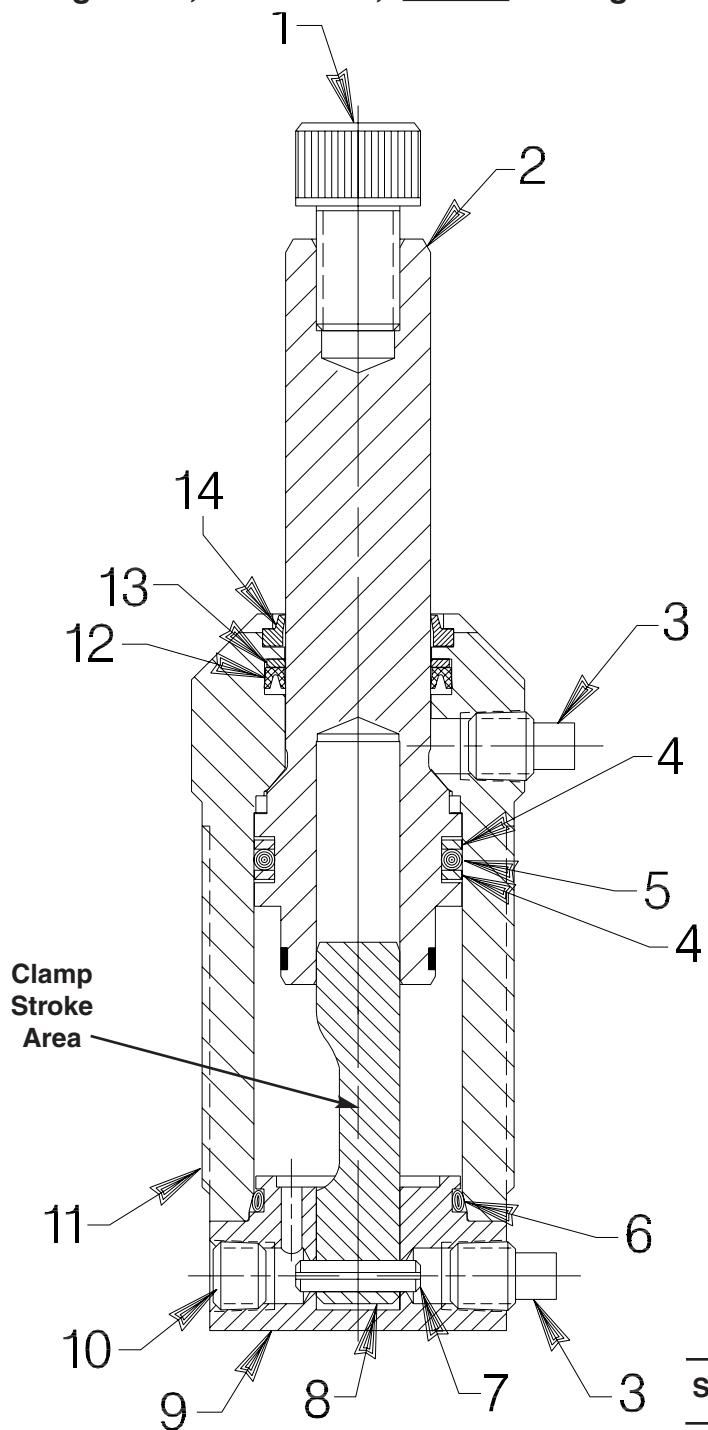

Refer to any operating instructions included with this product for detailed information about operation, testing, disassembly, reassembly, and preventive maintenance.

Items found in this parts list have been carefully tested and selected. Therefore: Use only genuine Hytec replacement parts!

Additional questions can be directed to our Technical Services Department.

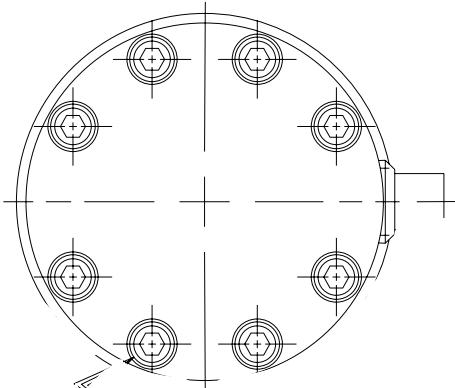

**BOTTOM VIEW**

Item No.	Part No.	No. Req'd	Description
1	<b>213836</b>	1	Hex. Soc. Hd. Cap Screw (1/2-20 UNF x 3/4 Lg.; Torque to 40/60 ft. lbs.)
2	<b>351025</b>	1	Piston Rod, Roller and Retainer Assembly (For 100841, 100842 & 100870)
	<b>351026</b>	1	Piston Rod, Roller and Retainer Assembly (For 100848, 100849 & 100871)
3	<b>11048</b>	2	Square Drive Plug Fitting (1/8 NPTF)
4	<b>*19140</b>	2	Backup Washer (1-1/4 x 1" x .048 Thk.)
5	<b>*250481</b>	1	O-ring
6	<b>*12598</b>	1	O-ring (1-5/16 x 1-1/8 x .093)
7	<b>10782</b>	1	Slotted Spring Pin (3/16 dia. x 3/4 Lg.)
8	<b>350397</b>	1	Rotating Cam (Right Hand† 90° for 100842)
	<b>350912</b>	1	Rotating Cam (Right Hand† 30°)
	<b>350913</b>	1	Rotating Cam (Right Hand† 45°)
	<b>350914</b>	1	Rotating Cam (Right Hand† 60°)
	<b>350398</b>	1	Rotating Cam (Left Hand† 90° for 100841)
	<b>350915</b>	1	Rotating Cam (Left Hand† 30°)
	<b>350916</b>	1	Rotating Cam (Left Hand† 45°)
	<b>350917</b>	1	Rotating Cam (Left Hand† 60°)
	<b>350283</b>	1	Rotating Cam (Left Hand† 90° for 100848)
	<b>350280</b>	1	Rotating Cam (Right Hand† 90° for 100849)
	<b>350343</b>	1	Rotating Cam (Straight Pull for 100870)
	<b>350344</b>	1	Rotating Cam (Straight Pull for 100871)
9	<b>350396</b>	1	End Cap
10	<b>15499</b>	1	Level Seal Plug Fitting (1/8 NPTF)
11	<b>64166</b>	1	Swing Clamp Body (For 100841, 100842 & 100870)
	<b>64189</b>	1	Swing Clamp Body (For 100848, 100849 & 100871)
12	<b>*250480</b>	1	V-cup
13	<b>*250479</b>	1	Backup Washer (1.113 x 7/8 x .048 Thk.)
14	<b>*250478</b>	1	Rod Wiper
15	<b>250476</b>	8	Hex. Soc. Hd. Cap Screw (#6-32 UNC x 3/4 Lg.; Torque to 30-40 in. lbs.)

NOTE: Flat of cam (clamp stroke area) to be opposite of body port.  
Grease roller in piston rod (Item #2) and cam with a light coating of CDM Extreme Pressure Lube #3.

Part numbers marked with an asterisk (\*) are contained in Repair Kit No. 300610.

†Right hand rotation is clockwise rotation when viewed from the piston rod end.

Left hand is counterclockwise rotation. To reverse clamp rotation, order the appropriate rotating cam.

Note: Shaded areas reflect last revision(s) made to this form.